

Manhole Inspection Summary

Manhole # S41A2_012MH

Printed On: 7/24/2008

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **41A2** Node: **012** Status: **Found**

Insp Date: **12/6/07 8:41 AM**

Incomplete Comments

Crew: **C**
Inspector: **CrewC**
Firm: **KEC**

Location Address: **9th St.** Cross Street: **E. Patapsco Ave.**

Manhole Type: **Junction** Location: **Roadway** Ground Conditions: **Wet**
☐ Prev. Rehab Weather: **Snow** Subject To Ponding: **None**

Comments **Large rock blocking pipe preventing measurement of influent pipe @ 3 O'clock**

Cover Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)
Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**
Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **1.5** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☒ Exists Material: **Brick** ☐ Parged Height: **8** (in.)
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged
Shape: **Circular** Diameter: **42** (in.) Length: (in.)
Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated
Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Channel Material: **Brick** ☐ Parged
Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:
Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps Count: **4** Missing: **0** ☐ Corroded

Surcharge ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S41A2_012MH

Printed On: 7/24/2008


Page 2 of 4

Location View



9th St.

Top View

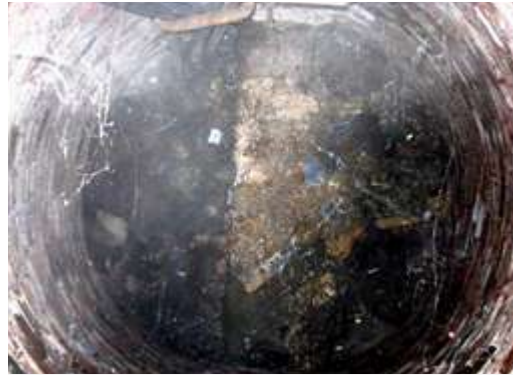

Steps



Defect 1



Channel clogged

Defect 2



Fame offset/loose bricks

Manhole Inspection Summary

Manhole # S41A2_012MH

Printed On: 7/24/2008

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **9.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.24** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **5** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Service Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **3.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☐ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **5** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Dead End**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S41A2_012MH

Printed On: 7/24/2008

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: **9.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.76** (ft.) Flow Characteristics: **None**

Deposits: ☐ None ☒ **Mud** ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **5** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection